

Pressure switch, heavy-duty version TPST Model PSM-530

WIKA data sheet PV 35.02

Applications

- Compressors

Special features

- Setting ranges 1 ... 4 to 7 ... 15 bar
[0.1 ... 0.4 to 0.7 ... 1.5 MPa]
- Electrical rating up to AC 440 V, 9 A
- Including On/Off switch to turn off the compressor manually
- Integrated relief valve to ensure a smooth restart of the compressor



Fig. left: Model PSM-530, standard version
Fig. right: Model PSM-530 with relief valve

Description

The model PSM-530 is used in industrial control, monitoring and alarm applications. The switch point can be specified by the customer on site.

The instrument can switch electrical loads of up to AC 440 V, 9 A.

The integrated relief valve (option) is used for depressurising the pressure chamber of the compression piston before starting the compressor.

With the manual On/Off switch, the contact system can be locked in the open position, irrespective of the process pressure.


Specifications

Unit	Setting range ¹⁾	Permissible switch point on rising pressure	Adjustable switch differential ²⁾	Max. working pressure
bar	1 ... 4	1.7 ... 4	0.7 ... 3	8
	2.5 ... 9.5	4.3 ... 9.5	1.8 ... 7	20
	7 ... 15	9.3 ... 15	2.3 ... 7	20
MPa	0.1 ... 0.4	0.17 ... 0.4	0.07 ... 0.3	0.8
	0.25 ... 0.95	0.43 ... 0.95	0.18 ... 0.7	2
	0.7 ... 1.5	0.93 ... 1.5	0.23 ... 0.7	2

1) Switch point and reset point have to be within the setting range
2) The difference between the switch point and the reset point is also known as switch hysteresis

Non-repeatability of the switch point
≤ 2 % of span

Switch contact
3-pole normally closed / TPST

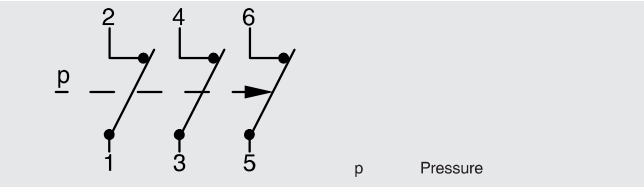

Also usable as 2-pole normally closed / DPST or
1-pole normally closed / SPST.

Manual On/Off switch (optional without)
For locking the contact system in the open position
Off: Switch contact is positively opened by hand
On: Switch contact is opened/closed per switch point setting

Current consumption ³⁾	Voltage	Current
Inductive load AC-15	AC 230 V/ AC 440 V	9 A

3) per DIN EN 60947-1

Depending on the load characteristics, additional protective measures, e.g. for motor protection, may be required.


Operating conditions

Permissible temperature ranges
Ambient: -40 ... +70 °C [-40 ... +158 °F]
Medium: -20 ... +70 °C [-4 ... +158 °F]
Storage: -20 ... +80 °C [-4 ... +176 °F]

Reference conditions

Relative humidity per BS 6134
< 50 % r. h. at 40 °C [104 °F]
< 90 % r. h. at 20 °C [68 °F]

Terminal assignment

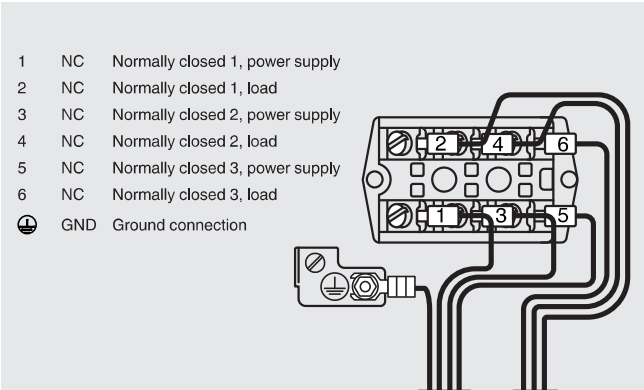

Electrical connection
2x rubber grommet for cables Ø 6 ... 14 mm
[Ø 0.24 ... 0.55 in]

Ingress protection per IEC/EN 60529
IP44

Relief valve (option)
¼ NPT, flare port

Process connections

Process connection per	Thread size
ISO 228-1	G ¼ female
	G ½ female

Materials

Wetted parts
Diaphragm: NBR
Process connection: Aluminium die-casting

Approvals


Logo	Description	Country
CE	EU declaration of conformity ■ Low voltage directive ■ RoHS directive	European Union


Approvals and certificates, see website

Mounting


Mounting option

Direct mounting

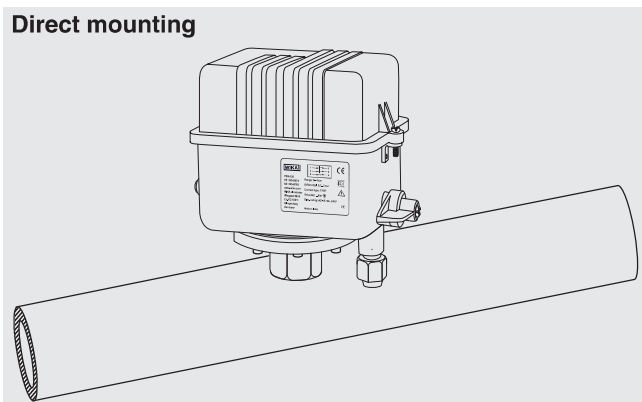

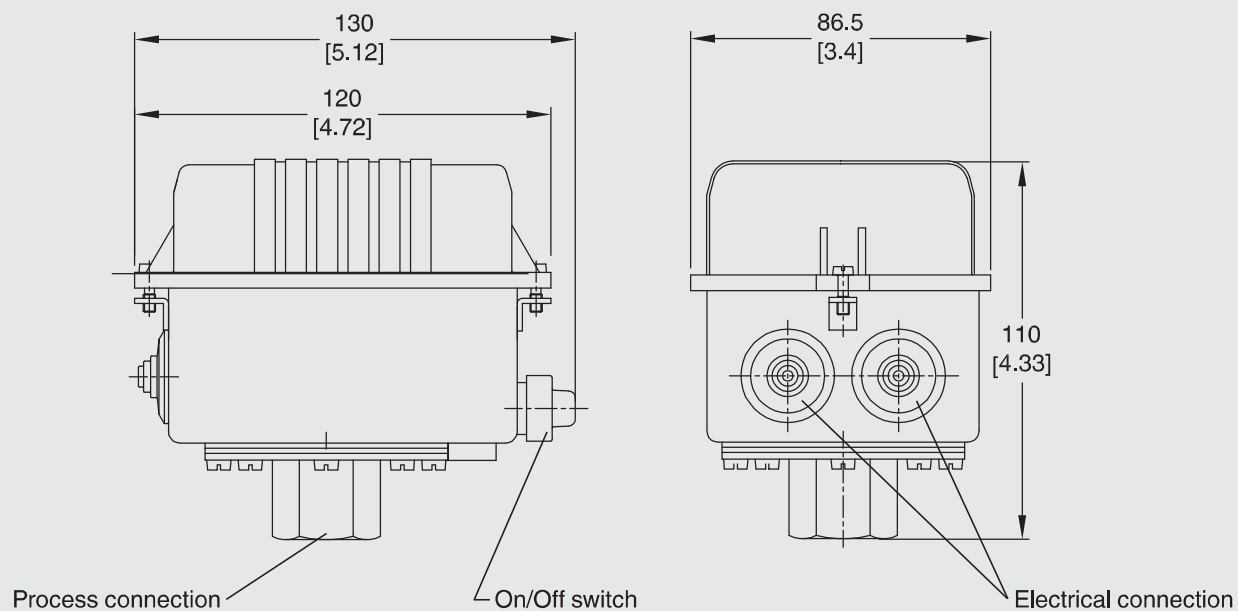
Dimensions in mm [in]**Standard version**

Weight: approx. 938 g [33 oz]

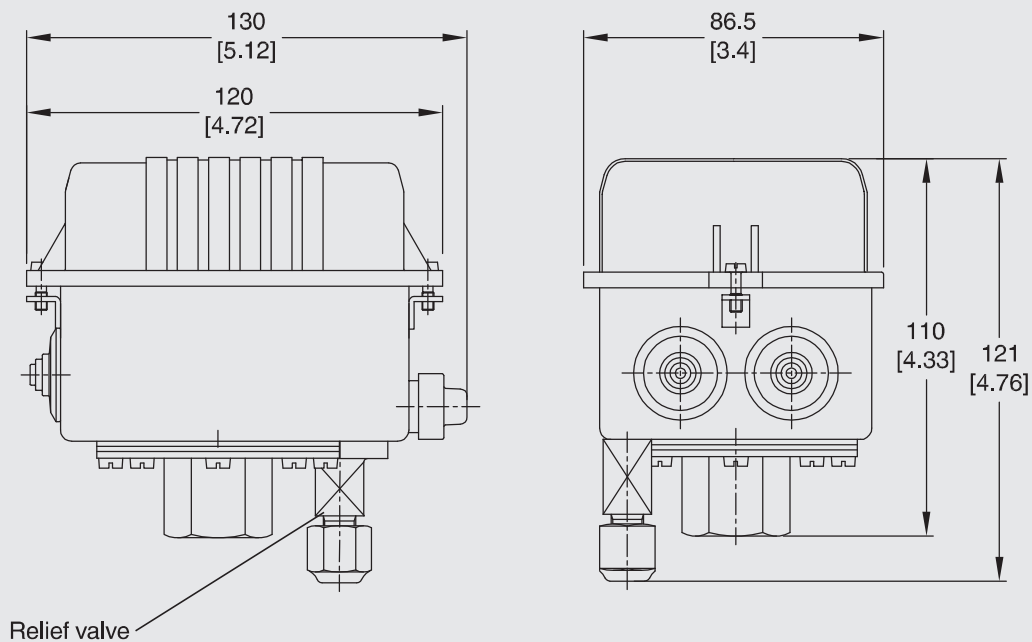Version with relief valve (option)

Process connections

Thread per ISO 228-1

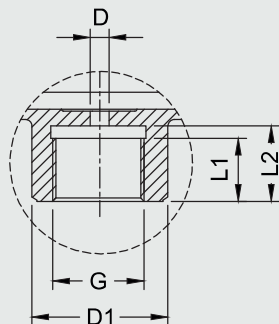

Dimensions in mm [in]

G	D	D1 ¹⁾	L1	L2
G ¼ female	Ø 4.5 [0.178]	SW 30 [1.18]	15 [0.59]	18 [0.71]
G ½ female				

1) SW = spanner width

Ordering information

Model / Relief valve / Manual On/Off switch / Setting range / Process connection

© 07/2018 WIKA Alexander Wiegand SE & Co. KG, all rights reserved.
The specifications given in this document represent the state of engineering at the time of publishing.
We reserve the right to make modifications to the specifications and materials.